

# Entune Audio Head Unit Software Update (Panasonic)

**Service Category** Audio/Visual/Telematics

**Section** Audio/Video

**Market** USA

Toyota Supports  
ASE Certification 

## Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2014 – 2015	4Runner, Highlander, Highlander HV, Sequoia, Tacoma, Tundra	

### SUPERSESSION NOTICE

The information contained in this bulletin supersedes SB No. T-SB-0006-14.

- Applicability has been updated to include 2015 model year applicable vehicles.

Service Bulletin No. T-SB-0006-14 is Obsolete and any printed versions should be discarded. Be sure to review the entire content of this bulletin before proceeding.

### NOTE

This bulletin does NOT apply to 2015 model year Sienna vehicles.

## Introduction

Some 2014 model year applicable vehicles equipped with Entune™ Audio (version 010169) / Entune™ Audio Plus (version 010171) / Entune™ Premium Audio (version 010185) may exhibit one or more of the following conditions:

- Bluetooth® sometimes disconnects with Android™ phones
- Bluetooth® disconnects with iPhone® 4 when connected to USB
- Radio reboots with heavy radio load condition (e.g., dual map and POIs ON and Entune™ Audio music ON and multiple destinations set) (Entune™ Premium Audio only)
- Radio reboots after completing a navigation route by voice command system and pressing Talk Switch (Entune™ Premium Audio only)

Some 2014 model year applicable vehicles equipped with Entune™ Audio (version 010173) / Entune™ Audio Plus (version 01017C) / Entune™ Premium Audio (version 010195) may exhibit one or more of the following conditions:

- Voice command screen is cancelled by pop-up screen

## **Entune Audio Head Unit Software Update (Panasonic)**

---

### **Introduction (Continued)**

- Voice command system does not respond for an extended period of time
- Radio reboots and navigation route is deleted (Entune™ Premium Audio only)
- Bluetooth® disconnects when phone is connected to Bluetooth® Audio from USB connection
- Radio reboots after entering a particular address as destination (Entune™ Premium Audio only)
- Route guidance is lost after ACC is cycled and after arriving at second destination (Entune™ Premium Audio only)

Some 2014 model year applicable vehicles equipped with Entune™ Audio (version 010179) / Entune™ Audio Plus (software version 010183) / Entune™ Premium Audio (software version 0101A1) may exhibit one or more of the following conditions:

- Radio reboots after using voice command system or after screen goes blank (Entune™ Premium Audio only)
- Bluetooth® disconnects or repeats disconnect and connect
- Entune™ is inoperative (Entune™ Premium Audio only)
- Radio freezes when certain Home address is set as destination (Entune™ Premium Audio only)
- House number is not displayed in Home or preset locations (Entune™ Premium Audio only)

Some 2014 model year applicable vehicles equipped with Entune™ Audio (software version 01017B) / Entune™ Audio Plus (software version 010185) / Entune™ Premium Audio (software version 0101A5) may exhibit one or more of the following conditions:

- Navigation re-route pop-up comes up continuously (Entune™ Premium Audio only)
- No map is displayed with new vehicles (Entune™ Premium Audio only)
- “i” button is displayed when navigation route guidance is not used (Entune™ Premium Audio only)
- Radio screen goes blank or freezes occasionally while using navigation function (Entune™ Premium Audio only)
- Radio reboots when an Apple® device which has 9,999 songs or more is connected
- Unselected music is played when certain playlists are selected by voice commands
- CD does not play occasionally
- Voice prompt ends unexpectedly while trying to make a call by voice commands
- Voice commands are inoperative for music
- Radio screen goes black after using voice commands

## **Entune Audio Head Unit Software Update (Panasonic)**

---

### **Introduction (Continued)**

Some 2014 model year applicable vehicles equipped with Entune™ Audio (software version 010180) / Entune™ Audio Plus (software version 01018B or 010190) / Entune™ Premium Audio (software version 0101B1 or 0101BE) may exhibit one or more of the following conditions:

- Bluetooth® call cannot be muted
- Email/Text message does not display and keeps showing “Loading message list”
- Radio reboots when text message is received
- Pandora® sound is interrupted
- No sound if “Ringtone Volume” and “Message Readout Volume” are changed during Bluetooth® connection
- Radio reboots when some HD radio channels are received
- Radio reboots with Bluetooth® operation.
- iPod® is paused after Bluetooth® phone call
- Pop noise from AM radio
- Noise on AM radio when brake is pressed in hybrid vehicles
- Destination cannot be set (Entune™ Premium Audio only)
- Distance to traffic incident is shown incorrectly (Entune™ Premium Audio only)
- Intersection map is not displayed (Entune™ Premium Audio only)
- Traffic incident icon is not displayed (Entune™ Premium Audio only)
- Radio freezes with navigation operation (Entune™ Premium Audio only)
- Touch screen becomes unresponsive after setting destination nearby and pop-up screen of “You are nearby” is displayed (Entune™ Premium Audio only)
- Arrival time shows incorrectly after destination is set (Entune™ Premium Audio only)
- Radio reboots with navigation operation (Entune™ Premium Audio only)
- Along My Route POI search does not show any results (Entune™ Premium Audio only)
- Traffic information icon is not displayed after returning from future time prediction to Now (Entune™ Premium Audio only)
- Traffic event icon disappears after going to traffic forecast (Entune™ Premium Audio only)
- Traffic information is not displayed (Entune™ Premium Audio only)
- Doppler traffic is not displayed after removing map SD card and reinserting it. (Entune™ Premium Audio only)

## Entune Audio Head Unit Software Update (Panasonic)

### Introduction (Continued)

- Traffic event does not display intermittently (Entune™ Premium Audio only)

Updated system software is now available to address these conditions. Follow the repair procedure in this bulletin to install the latest software version.

### Warranty Information

OP CODE	DESCRIPTION	MODEL	TIME	OFP	T1	T2
EL1318	Software Update	4Runner	0.3	86100-35260 86100-35270 86100-35320	87	74
		Highlander Highlander HV		86804-0E110 86804-0E120		
		Sequoia		86140-0C060 86140-0C070 86804-0C030 86804-0C050		
		Tacoma		86140-04040 86140-04120 86140-04130 86140-04150 86804-04010 86804-04030 86804-04050 86804-04070		
		Tundra		86140-0C010 86140-0C021 86140-0C040 86140-0C050 86804-0C070 86804-0C080 86804-0C090 86804-0C100		

#### APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

## Entune Audio Head Unit Software Update (Panasonic)

### Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY	HEAD UNIT	APPLICABLE FILE ON THE USB DRIVE*
USB Drive Firmware Update - Panasonic*	<a href="#">01030-PANSC-14C</a>	1	Entune™ Audio	<a href="#">13TBDANA-DA00_0133.kwi</a>
			Entune™ Audio Plus	<a href="#">13TDDANA-DA00_0145.kwi</a>
			Entune™ Premium Audio	<a href="#">13TDANNA-DA00_0193.kwi</a>

\* Essential SST.

### MULTIMEDIA SOFTWARE FILE DOWNLOAD

The Multimedia software update file may also be downloaded directly from this Service Bulletin by clicking on the file name in the table above. The file may be saved directly to a commonly-available blank USB flash drive.

For USB flash drive requirements and download instructions:  
Refer to the Technical Information System (TIS): *Diagnostics – Calibrations – Reference Documents* – [“Multimedia Software Download Instructions”](#)

### NOTE

Additional SSTs may be ordered by calling 1-800-933-8335.

### Software Update

1. Confirm the audio system type by checking the Panel ID printed on the bottom-right or bottom-center of the machine.

Figure 1. Highlander, Highlander HV, Sequoia, Tacoma, & Tundra


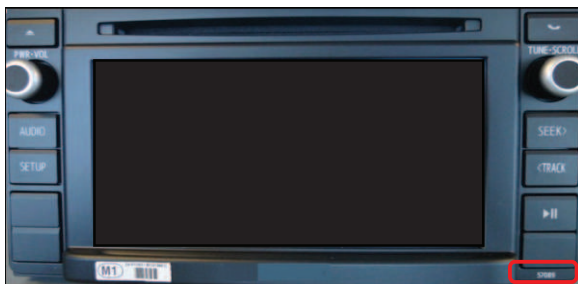


Figure 2. 4Runner

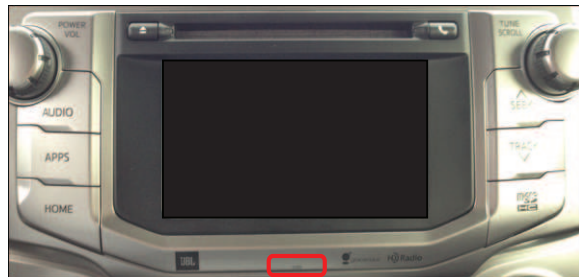

## Entune Audio Head Unit Software Update (Panasonic)

---

### Software Update (Continued)

**Table 1. Panel ID Information**

Model	Entune™ Audio	Entune™ Audio Plus	Entune™ Premium Audio
4Runner	N/A	N/A	57079 57080 57085
Highlander Highlander HV	N/A	N/A	57063 57064
Sequoia	57096	57097	57099 570A1
Tacoma	57089 510078	57090 510079 510080	57092 57094 510074 510075 510076 510077
Tundra	57067	57068 57070 57071	57072 57073 57074 57075

2. Insert the USB Drive SST into the vehicle USB port.
3. Start the engine.

## Entune Audio Head Unit Software Update (Panasonic)

### Software Update (Continued)

4. Go to the *Setup* screen.


#### A. For Entune™ Audio:

Press the *SETUP* button on the panel.

**Figure 3. Tacoma, Sequoia**



**Figure 4. Tundra**

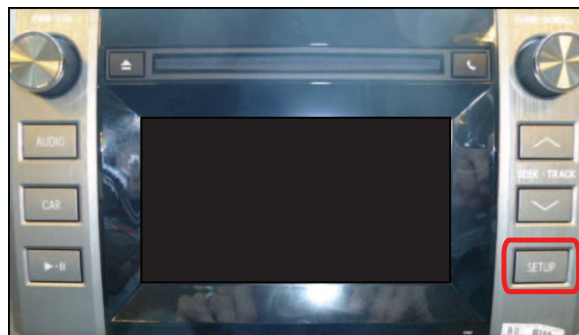


#### B. For Entune™ Audio Plus / Entune™ Premium Audio:

(1) Press the *APPS* button on the panel.

**Figure 5. 4Runner, Highlander, Highlander HV, Sequoia, Tacoma & Tundra**




**Figure 6. Tundra**

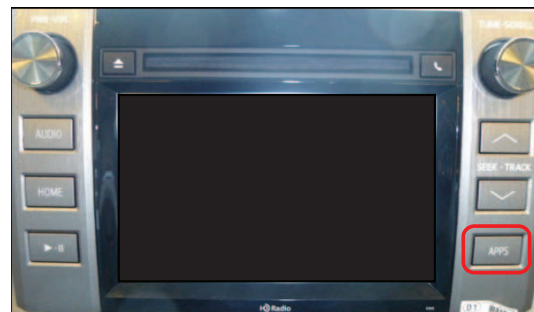

#### NOTE

If Entune™ pop-up displays, select **OK**.

**Figure 7.**

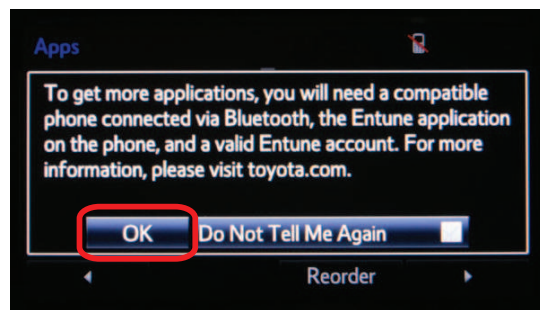


## Entune Audio Head Unit Software Update (Panasonic)

### Software Update (Continued)


- (2) Select *Setup* on the *Apps* screen.

Figure 8.

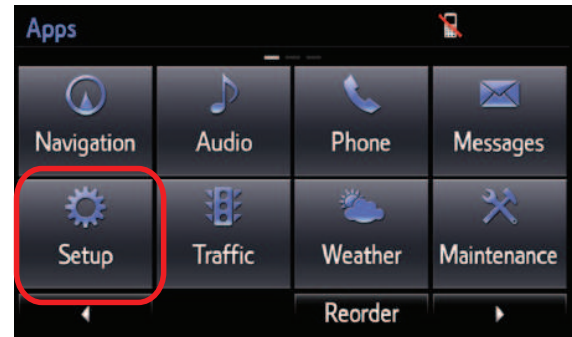


5. Select *General* on the *Setup* screen.

Figure 9.

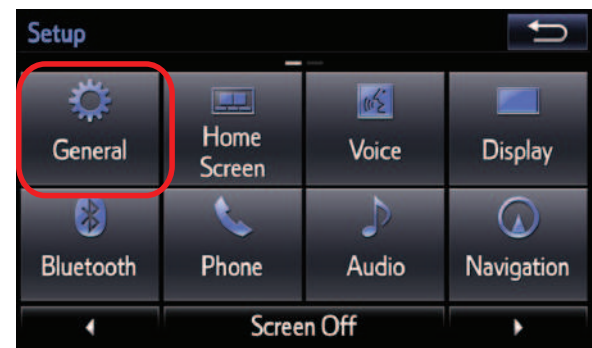

6. Select *Software Update* from the list on the *General Settings* screen.

Figure 10.

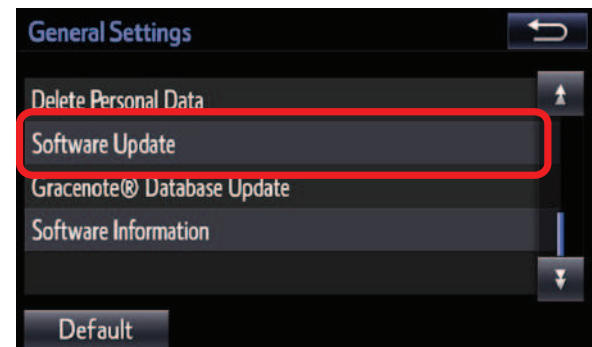

**HINT**

Scroll down the list until *Software Update* is displayed.




## Entune Audio Head Unit Software Update (Panasonic)

### Software Update (Continued)

7. Select *Update* on the *Software Update* screen.


Figure 11.

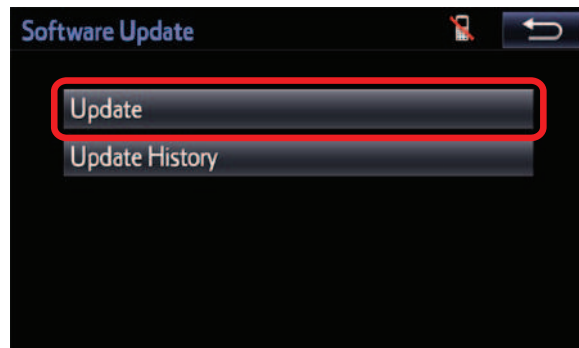

#### NOTE


If software has been detected properly, a "New software was found." pop-up will be displayed.

Figure 12.

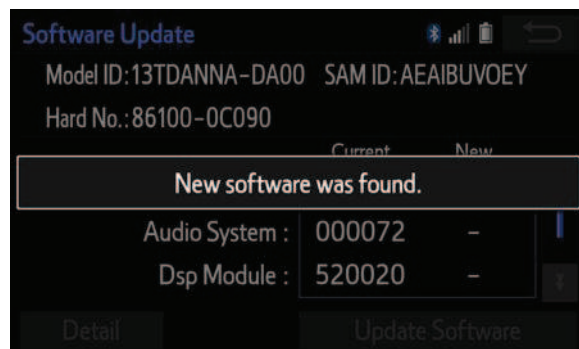

8. Verify that the new software is up-to-date on the *Software Update* screen.

Figure 13.

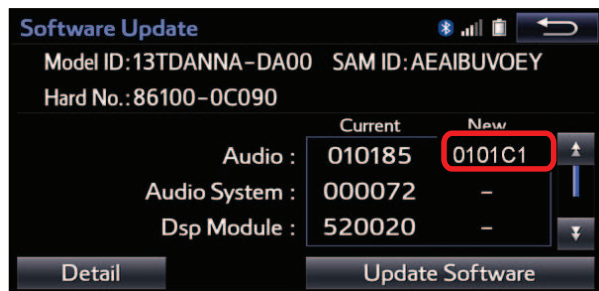

## Entune Audio Head Unit Software Update (Panasonic)


### Software Update (Continued)

**Table 2. Software Version Information**

Type	Entune™ Audio		Entune™ Audio Plus		Entune™ Premium Audio	
	Current Version	New Version	Current Version	New Version	Current Version	New Version
Audio	010169 010173 010179 01017B 010180	010185	010171 01017C 010183 010185 01018B 010190	010191	010185 010195 0101A1 0101A5 0101B1 0101BE	0101C1
Audio System	000072	–	000072	–	000072 000074 00007B	–
Dsp Module	420020	–	520020	–	520020 520050	–
Sub	010001	–	010001	–	010001	–
Can	130209	–	130209	–	130209	–


9. Select *Update Software* on the *Software Update* screen.

**Figure 14.**

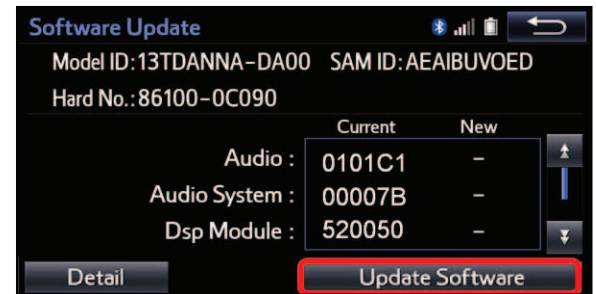

10. Select *Yes* on the “Would you like to start the software update?” pop-up.

**Figure 15.**

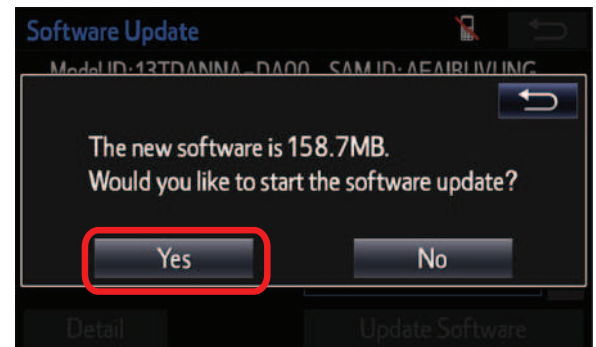

## Entune Audio Head Unit Software Update (Panasonic)


### Software Update (Continued)

11. The unit begins installation. The update will take about 10 minutes.

#### NOTE

- Do NOT turn off the engine or ACC before the software is ready for updating.
- Do NOT pull the USB Drive SST out of the vehicle USB port.

Figure 16.

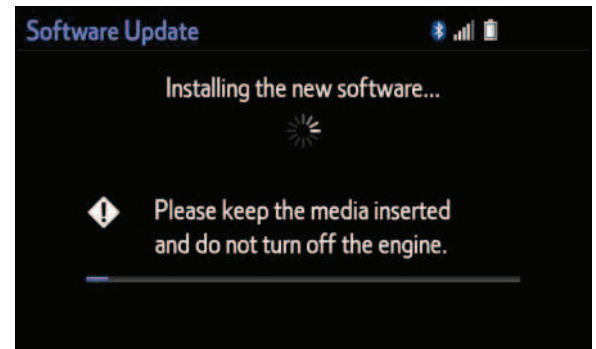

For Entune™ Premium Audio:

If update fails and the error message "New software is not compatible with the system." displays, cycle the ignition OFF, remove the Map Micro SD Card from the head unit, and repeat steps 2 – 11.

Figure 17.




#### NOTE

Software update error is more likely to occur in areas with more traffic information.

Once update is complete, reinsert the Map Micro SD card into the head unit, cycle the ignition OFF, and proceed to step 13.

12. When "The software is ready for updating." displays, cycle the ignition OFF.

Figure 18.

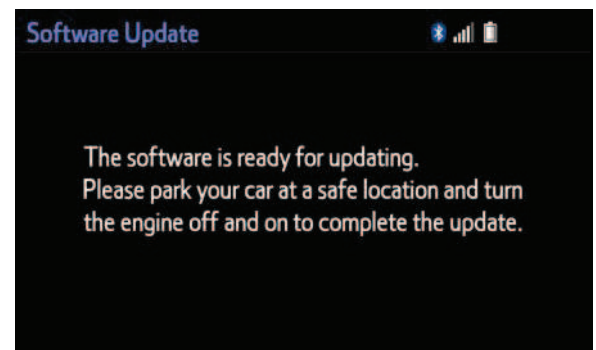

13. Remove the USB Drive SST from the vehicle USB port.

## Entune Audio Head Unit Software Update (Panasonic)

### Software Version Confirmation

1. Perform steps 3 – 7 of the Software Update procedure to re-enter the *Software Update* screen.
2. Verify that the software information is updated on the *Software Update* screen.

Figure 19.

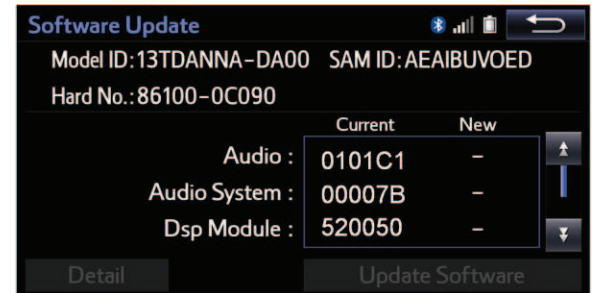


Table 3. New Software Version Information

Type	Entune™ Audio		Entune™ Audio Plus		Entune™ Premium Audio	
	Current Version	New Version	Current Version	New Version	Current Version	New Version
Audio	010185*	–	010191*	–	0101C1*	–
Audio System	000072	–	000072	–	000072 000074 00007B	–
Dsp Module	420020	–	520020	–	520050	–
Sub	010001	–	010001	–	010001	–
Can	130209	–	130209	–	130209	–

\* Updated version information